



Door Preparation Instructions for Door with No Holes

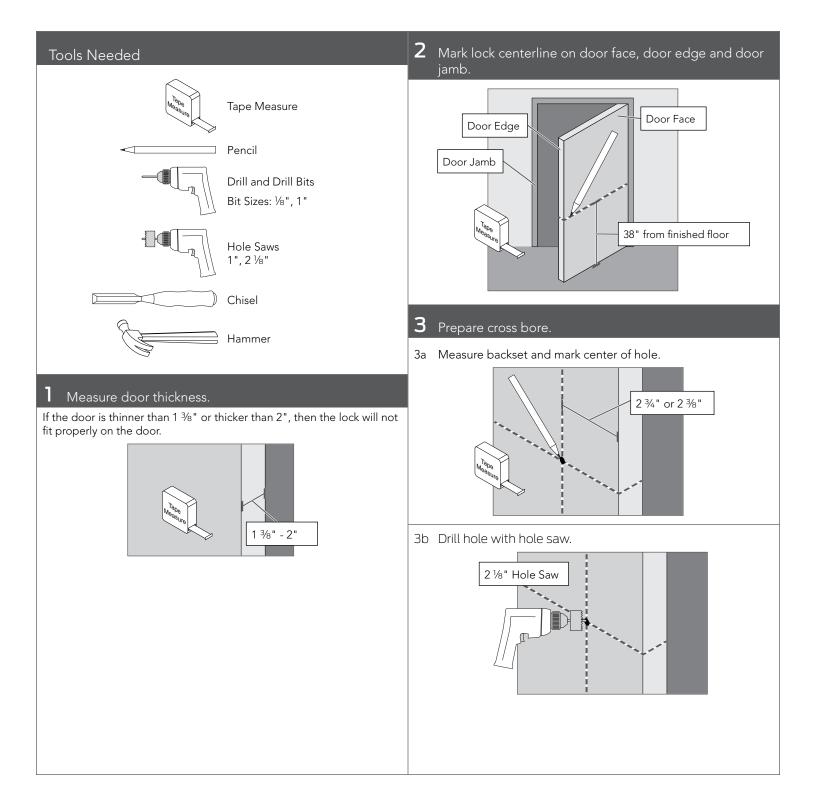


4 Prepare door edge hole.

4a Measure and mark $\frac{1}{2}$ door thickness.

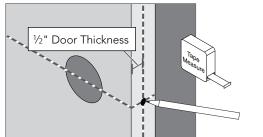


4b Drill hole in door edge.

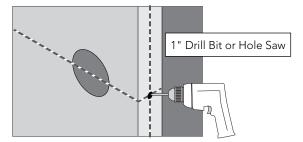


5 Mortise for bolt.


Insert bolt into door edge hole. Trace bolt faceplate and mark 5a holes.

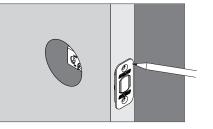

5b Remove bolt and drill two ¹/₈" pilot holes.

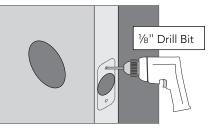


5c Use chisel and hammer to create bolt mortise.

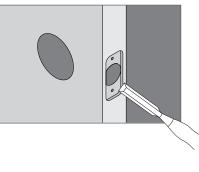


Product Support 800-847-1864 www.allegion.com


- 6 Measure, mark and drill holes in door jamb for strike.
- 6a Mark center for strike hole exactly opposite latch hole.

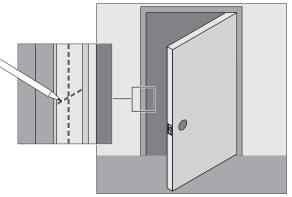

6b Measure, mark and drill two (2) 1" holes, 1 ¼" deep, as shown. Chisel out excess material on the sides.

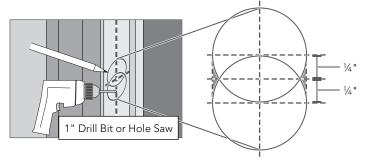

- 7 Mortise for strike and reinforcement plate.
- 7a Trace strike and reinforcement plate and mark holes.



7b Drill four (4) ¹/₈" pilot holes.



7c Use chisel and hammer to create mortise for strike and reinforcement plate.





© Allegion 2025 schlage arrive door prep no holes-a Rev. 06/25-a